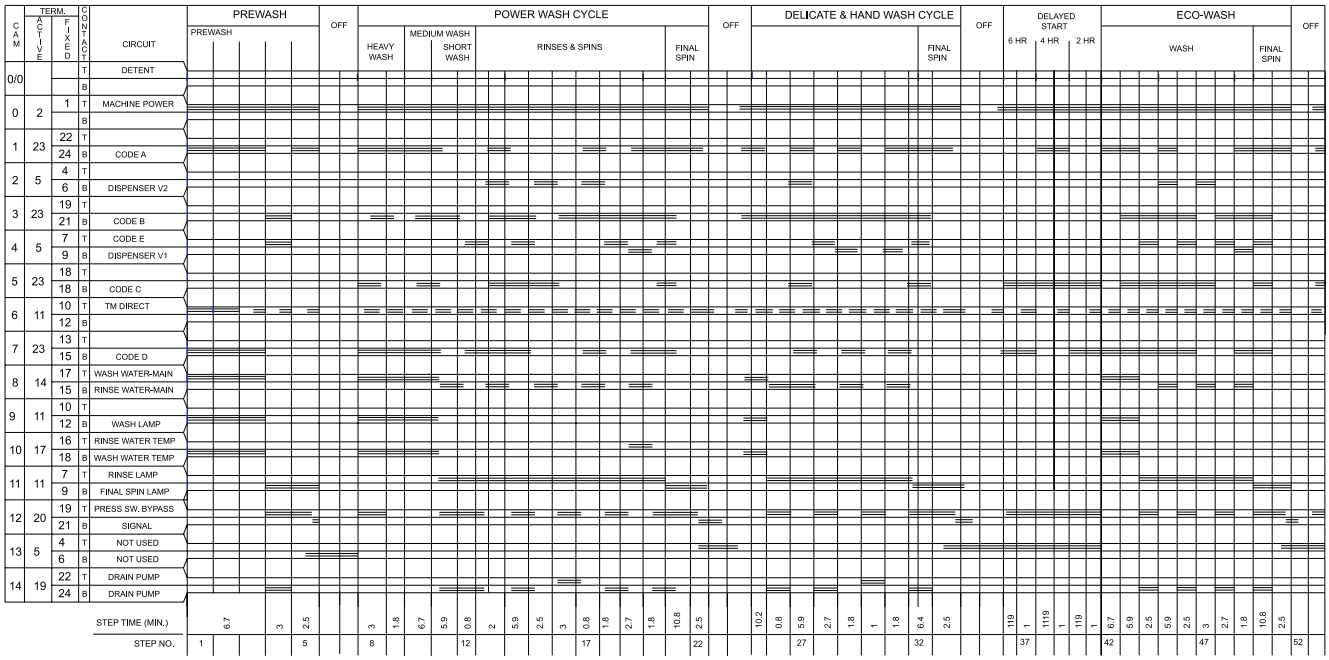

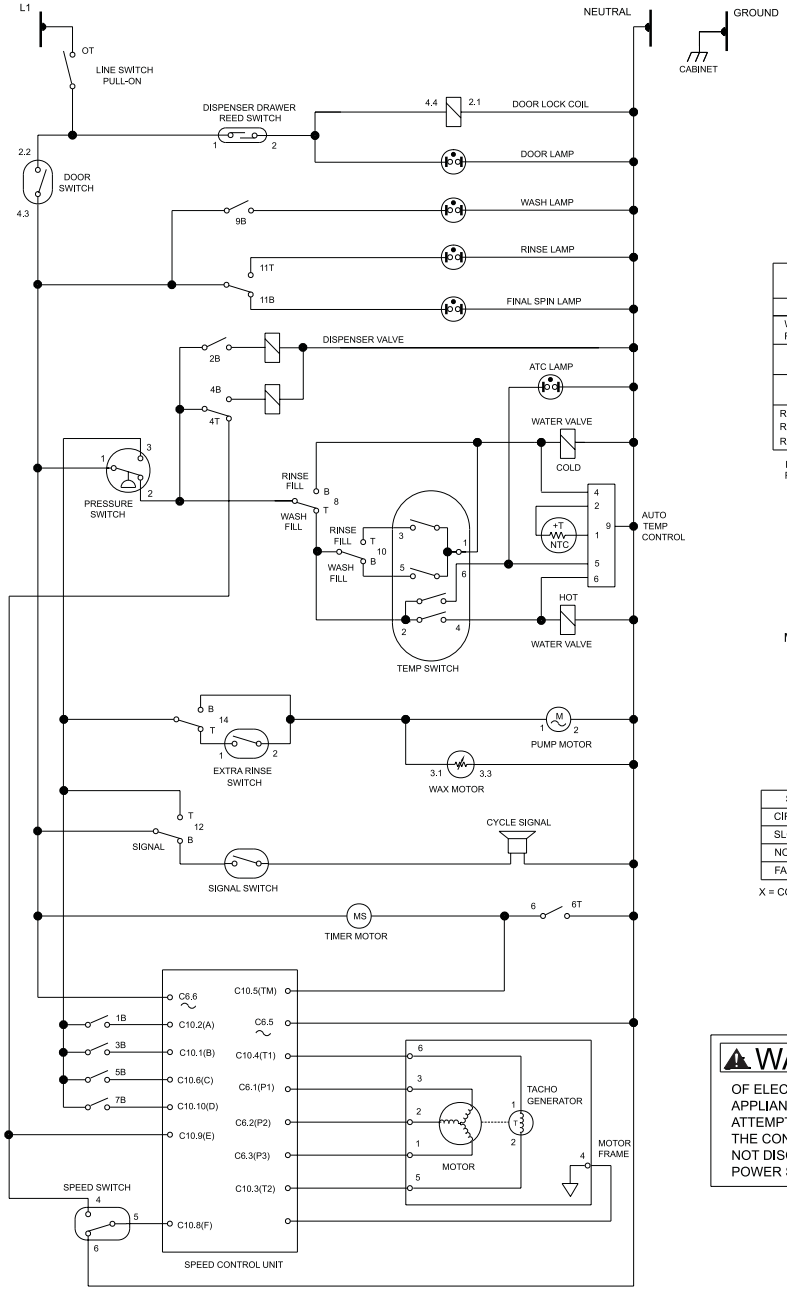

COMPONENT RESISTANCE TABLE		
ELECTRICAL COMPONENT		RESISTANCE Ω @ 77°F (25°C)
WATER VALVE SOLENOIDS		880 ±10%
DOOR LOCK SOLENOID		380 ±10%
TIMER MOTOR		2425 ±6%
PUMP MOTOR		15 ±7%
DISPENSER VALVE SOLENOIDS		1100 ±7%
MOTOR	M1 TO M2	2,6 ±7%
	M2 TO M3	2,6 ±7%
	M1 TO M3	2,6 ±7%
	M5 TO M6	184 ±7%

TEMPERATURE SWITCH				
	CIRCUIT			
WASH/ RINSE	1-3	1-5	2-6	2-4
H/C				X
W/C		X		X
C/C		X		
W/W	X	X		X
REG C/C		X	X	
REG W/C			X	X
REG W/W	X		X	X

H = HOT W = WARM C = COLD
REG = REGULATED X = CLOSED

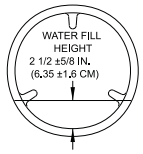

NO LOAD, START POSITION OF PERMANENT PRESS

MOTOR PLUG-MALE (END VIEW)

WIRING CODES
CONNECTION
NO CONNECTION
CABINET GROUND
LOCAL GROUND

SPEED SWITCH		
CIRCUIT	5-6	4-5
SLOW	X	
NORMAL		X
FAST		

X = CONTACTS CLOSED

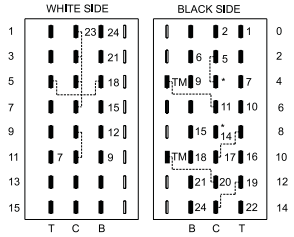

TIMER PLUG-MALE (END VIEW)

⚠ WARNING TO REDUCE THE RISK OF ELECTRICAL SHOCK DISCONNECT THIS APPLIANCE FROM THE POWER SUPPLY BEFORE ATTEMPTING ANY USER MAINTENANCE. TURNING THE CONTROLS TO THE OFF POSITION DOES NOT DISCONNECT THIS APPLIANCE FROM THE POWER SUPPLY.

WIRING DIAGRAM
P/N 134148800